



Project Name:	Mountain Valley Pipeline	Inspector:	Matthew Grant
Inspection Date:	Thursday, July 22, 2021	Project Contact:	Brian Clauto
Spread H: Montgomery	AR MN274, MN275 St 12180-12200 ATWS 703, 1446, 1375	Weather:	Dry

		4	AIVVS	703, 1446, 1375									
АСТ	VE STAGE	OE CONST	LBIIC.	FION: (Chack all th	aat annly)								
ACTIVE STAGE OF CONSTRUCTION: (Check all that apply)													
	Tree Fellin	Tree Felling $\hfill\Box$ Clearing/Grubbing $\hfill\Box$ Grading $\hfill\Box$ Trenching		Trenching		Stri	inging/Welding						
	Lowering/E	Backfilling		Final Grading		Temp. Stabilization		Perm. Stabilization	ı 🗵	rmant			
									Yes	No	N/A		
Are controls installed and implemented in accordance with the approved erosion and sediment control plan and stormwater management plans?								\boxtimes					
Are all control measures properly maintained in effective operating condition in accordance with good engineering practices and, where applicable, manufacturer specifications?								\boxtimes					
	3.	Areas of o	ffsite s	sediment deposition	observe	d?				\boxtimes			
 Comments: Inspected the following resources: S-OO11, S-C21 _ECD's were in place and functioning above the designated crossing. Routine Maintenance: (72-Hour Deadline from Notification) - N/A Ineffective Controls: (24-Hour Deadline from Notification) - N/A Recommended Corrective Action: N/A 													

Deadline: N/A

The recommended corrective action deadline date applies to all conditions noted on this report unless otherwise noted. If listed condition(s) currently constitute non-compliance and/or corrective actions are not completed by the deadline, other enforcement actions may be issued to the entity responsible for ensuring compliance on the above project.

Inspector Signature: _____

Date: Thursday, July 22, 2021

FIELD INSPECTION PHOTO LOG



Project Name: Mountain Valley Pipeline <u>Date</u>: Thursday, July 22, 2021

Figure 1: Designated crossing S-C21



Figure 2: Designated crossing S-OO11



 <u>Figure 3</u>: Construction road site not associated with the MVP project, fill slope not stabilized near S-OO11.



<u>Figure 4</u>: Construction road site not associated with the MVP project, fill slope and ditch line not adequately stabilized near S-C21.

