

FIELD INSPECTION

Project Name:	Mountain Valley Pipeline	Inspector:	Matthew Grant
Inspection Date:	Wednesday, June 12, 2019	Project Contact:	Brian Clauto
Spread: Pittsylvania County AR32 MP269-269	Spread I	Weather (Wet/Dry/Rain):	Dry

STAGE OF CONSTRUCTION: (Check all that apply)

- ☐ Clearing

☐ Rough Grading

☐ Trench Excavation

☐ Pipe Assembly, Testing & Installation

☐ Backfilling and Grade Restoration

☐ Final Grading & Stabilization

☒ Other: Dormant

- | | | Yes | No | N/A |
|---|---|-------------------------------------|-------------------------------------|--------------------------|
| 1 | Are controls installed and implemented in accordance with the approved erosion and sediment control plan and stormwater management plans? | ☒ | ☐ | ☐ |
| 2 | Are all control measures properly maintained in effective operating condition in accordance with good engineering practices and, where applicable, manufacturer specifications? | ☐ | ☒ | ☐ |
| 3 | Areas of offsite sediment deposition were observed? | ☒ | ☐ | ☐ |

Comments:

- Streams / wetlands inspected included: S-C19,S-F11, W-H2, W-H3, S-H5
- S-F11 bridge has been destroyed and debris is off the ROW
- St1423+00 undermined P1 fence
- St14219-14244+34 three sumps require maintenance
- St14248+12 evidence of rill erosion and flow path requires maintenance
- St14251+97 slip on slope
- St15919+20 CFS and P1 requires maintenance
- St15964+51-15947+75 escaped sediment in wetlands
- St15964+00 rill erosion leading to sump

Recommended Corrective Action: Maintain all controls per the approved plan and specs and remove escaped sediment and bridge debris.

Deadline: Within 24hr notification

The recommended corrective action deadline date applies to all conditions noted on this report unless otherwise noted. If listed condition(s) currently constitute non-compliance and/or corrective actions are not completed by the deadline, other enforcement actions may be issued to the entity responsible for ensuring compliance on the above project.

Inspector Signature: Matthew Grant Date: 6-24-19

FIELD INSPECTION PHOTO LOG

Project Name: Mountain Valley Pipeline

Date: Wednesday, June 12, 2019


- Fig. 1 St1423+00 undermined P1 fence



- Fig. 2 St14219-14244+34 three sumps require maintenance



- Fig. 3 St14248+12 evidence of rill erosion and flow path requires maintenance

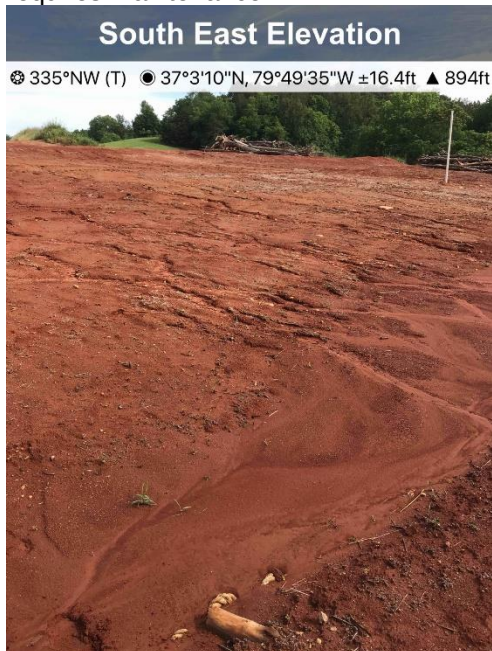

- Fig. 4 St14251+97 slip on slope




FIELD INSPECTION PHOTO LOG


Project Name: Mountain Valley Pipeline

Date: Wednesday, June 12, 2019

- Fig. 5 S-F11 bridge has been destroyed and debris is off the ROW

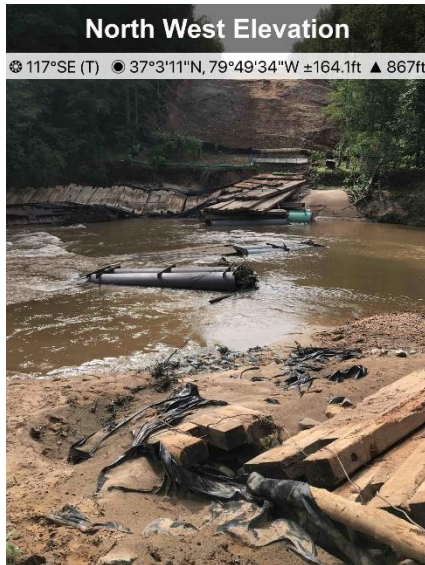

- Fig. 6 St15919+20 CFS and P1 requires maintenance

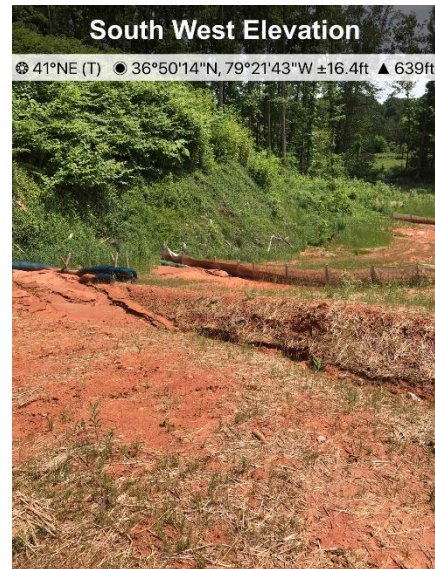

- Fig. 7 St15964+51-15947+75 escaped sediment in wetlands



- Fig. 8 St15964+00 rill erosion leading to sump

