

FIELD INSPECTION

Project Name:	Mountain Valley Pipeline	Inspector:	Marshall Willis
Inspection Date:	Wednesday, April 3, 2019	Project Contact:	Brian Clauto
Spread I: Pittsylvania County	Transco Interconnect	Weather (Wet/Dry/Rain):	Dry

STAGE OF CONSTRUCTION: (Check all that apply)

- ☐ Clearing
 ☐ Rough Grading
 ☐ Trench Excavation
 ☐ Pipe Assembly, Testing & Installation
☐ Backfilling and Grade Restoration
 ☒ Final Grading & Stabilization
 ☐ Other:

- | | Yes | No | N/A |
|---|-------------------------------------|-------------------------------------|--------------------------|
| 1 Are controls installed and implemented in accordance with the approved erosion and sediment control plan and stormwater management plans? | ☒ | ☐ | ☐ |
| 2 Are all control measures properly maintained in effective operating condition in accordance with good engineering practices and, where applicable, manufacturer specifications? | ☒ | ☐ | ☐ |
| 3 Areas of offsite sediment deposition were observed? | ☐ | ☒ | ☐ |

Comments:

Contractor actively converting temporary sediment basin (SB-1) to Permanent Stormwater Pond. Facility's liner is being installed today (4/3) and conversion will be complete by tomorrow (4/4) prior to expected rainfall on 4/5. Before bringing the SW facility online, all inlet channels and contributing drainage areas must be stabilized, facility must be installed per approved plans and any adjacent ROW disturbances must be stabilized to prevent discharge into stormwater pond. Any sediment entering the permanent facility once brought online, must be removed.

Channel H (CH-H) has been modified from the approved plans. CH-H as installed, converges with Channel L (CH-L) and discharges into the permanent stormwater facility. Deviation from the approved plans requires additional stormwater calculations and redlines to be submitted to DEQ for review and approval.

Recommended Corrective Action:

Deadline: Within 24-hr notification

The recommended corrective action deadline date applies to all conditions noted on this report unless otherwise noted. If listed condition(s) currently constitute non-compliance and/or corrective actions are not completed by the deadline, other enforcement actions may be issued to the entity responsible for ensuring compliance on the above project.

Inspector Signature: Marshall Willis

Date: 04/03/2019

FIELD INSPECTION PHOTO LOG

Project Name: Mountain Valley Pipeline

Date: Wednesday, April 3, 2019

Fig. 1: **Permanent Stormwater Pond** – Confluence of CH-F and CH-M into CH-H.



Fig. 2: **Permanent Stormwater Pond** – Confluence of CH-H into CH-L draining to SWP.



Fig. 3: **Permanent Stormwater Pond** – Inlet channel J (CH-J).



Fig. 4: **Permanent Stormwater Pond** – Inlet channel K (CH-K).



FIELD INSPECTION PHOTO LOG

Project Name: Mountain Valley Pipeline

Date: Wednesday, April 3, 2019

Fig. 5: **Permanent Stormwater Pond** – Installation of baffles and pond liner.



Fig. 6: **Permanent Stormwater Pond** – Installation of baffles and pond liner.

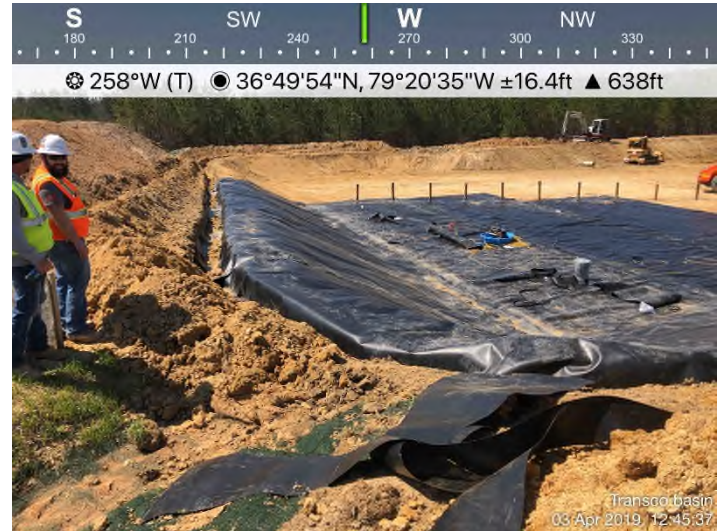


Fig. 7: **Permanent Stormwater Pond** – Outfall.



Fig. 8: **Permanent Stormwater Pond** – Emergency spillway.

